


TB056 (Rev1) - YCI-40 Spindle Damage

Overview

Chips can enter the motor adjustment slots on the Supermax YCI-40 knee mill and cause damage to the spindle carriage and housing, eventually making the Z-axis unreliable.

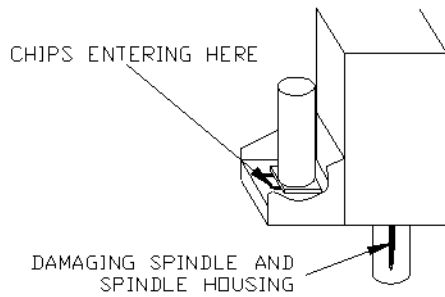

Solution

The defect can be resolved by fitting a cover over the slots or by covering the slots with silicon.

Document History

Rev1 Created on **1999-01-08**